



DL-1xxS-WF series

Update Patch V1.00

User Guide


Release Note

Version	Date	Description of changes
Rev1.00	2023-10-30	Fixed HTML negative value overflow.

1. Before patch the file, please make sure your device IP.
2. If device in station mode(STA), fill the IP address and press “Change IP”.
3. If you forget then “Reset” it back to Default AP mode, show as below.

Reset to Default:

Press & hold the reset button in right side over 6 Sec until the Red LED quick flash then release to restore DL-1xxS-WF default setting, default is set in AP mode (IP:192.168.77.1).

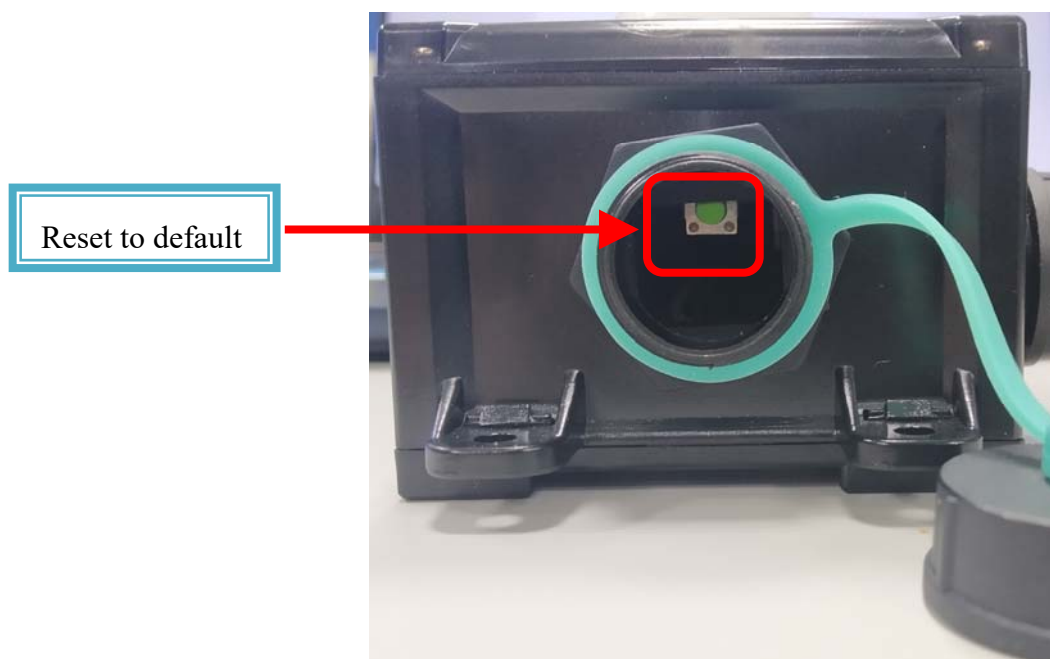

Reset button locate in the right side of the device

4. After Reset, connect your PC/NB to your Wi-Fi device by selecting AP similar as below, Controller's SSID in Wi-Fi AP mode, default will be DL-101S-WF-xxxxxx or DL-111S-WF-xxxxxx
5. After connected, run “DL_Update_Patch.exe”



DL-1xxS-WF Series Update Patch User Guide

DL-1x1S-WF F/W, HTML Update Patch V1.00(20231030)

Get Device Linked!!
DL-101S-WF Module **1**

2 **Link Device**

3 **Patch File**

4 **Change IP**

Remote IP : 192.168.77.1 Remote MAC: 00:0D:EC:A4:6C:11 Ver: 01.20 RSSI: -51dBm
Location : Not Set!! 0%

6. Press “Link Device” button(2) to re-Link your device, if link success it will show information like (1) & (4).
7. After that, press “Patch File” button(3), wait for the progress bar to 100% & message box show “Patch file complete!”.
8. Press “Link Device” button(2) to re-Link your device, you can see the version show “**Ver: 01.20**” that mean the new patch file is running.